The Samuel Dutrow Farmstead is centered on a two-story frame dwelling with a cross gable and a two-story rear wing with decorative details in the gable peak, shingles on the end gable, and a one-story porch with several bands of scroll-sawn molding. The outbuildings include a group of three domestic structures, an ice house/meathouse, a chicken house, and a garage, and a free-standing two-story wash house, two other chicken houses, a frame and stone bank barn, a wagon shed/corn crib, and a concrete block dairy barn and milk A blacksmith shop near the barn is partially collapsed. Currently house. unoccupied, the house is in fair condition and has three mantelpieces with raised molded panels on the first floor. The farm was established and the house probably built about 1872 by Samuel Dutrow, the owner of several farms in the Adamstown Region. This farm was an investment and was probably occupied by a tenant farmer. It was sold to George S. Allnutt in 1915. The farmstead is moderately significant for the architecture of the house, with its remaining fine scroll-sawn trim on the interior and exterior. It reflects in a modest way the level of craftsmanship commonly found in the late 19th century in the Buckeystown vicinity, where a reputation for fine carpentry was established during this period. The farmstead is also notable for the variety of outbuildings which survive, although their general condition is fair to The range of uses shows the progression from self-sufficient grain-producing farms to dairy farms oriented to commercial production, during the period 1870-1930.

F-1-178 Samuel Dutrow Farmstead Tuscarora Frederick County

HISTORIC CONTEXT:

MARYLAND COMPREHENSIVE HISTORIC PRESERVATION PLAN DATA

Geographic Organization: Piedmont

(Harford, Baltimore, Carroll, Frederick, Howard, Montgomery

Counties, and Baltimore City)

Chronological/Development Period:

Industrial/Urban Dominance, A.D. 1870-1930

Modern Period, A.D. 1930-Present

Prehistoric/Historic Period Themes

Agriculture

Architecture, Landscape Architecture and Community Planning

Resource Type:

Category: Building

Historic Environment: Rural

Historic Function & Use:

Domestic/single dwelling/residence Domestic/secondary structure/kitchen Domestic/secondary structure/garage

Agriculture/subsistence/animal facility/chicken coop

Agriculture/subsistence/animal facility/barn

Agriculture/subsistence/storage/granary

Known Design Source: None

MARYLAND INVENTORY OF

Maryland Historical Trust HISTORIO PROPERTIES State Historic Sites Inventory Form

Magi No.

DOE __yes x no

Survey No. F-1-178

1. Nam	e (indicate p	referred name)		
historic Sam	uel Dutrow Farmste	ad		
and/or common				
2. Loca	ation			
street & number	· 1919A Buckeysto	wn Pike		not for publication
city, town Tus	carora	_x_ vicinity of	congressional district	6th
state Mar	yland	county	Frederick	
	sification			
Category district ×_ building(s) structure site object	Ownership public private both Public Acquisition in process being considered not_applicable	Status X occupied unoccupied work in progress Accessible yes: restricted yes: unrestricted no	Present Use X agriculture Commercial educational entertainment government industrial military	museum park x private residence religious scientific transportation other:
4. Own	er of Prope	erty (give names a	and mailing address	es of <u>all</u> owners)
name Ste	ven A. and Arthur	T. Shook		
street & number	1 9 19B Buckeyst	own Pike	telephone :	no.:
city, town	Adamstown	state	and zip code MD.	21710
	ation of Leg	gal Descripti	on	4
		rederick County Cour		liber ¹⁶³⁹
street & number	100 W. Patrick	Street		folio 369
city, town F1	rederick		state	MD. 21701
6. Rep	resentatior	in Existing	Historical Sur	veys
title				
date			federal st	ate county loca
epository for s	urvey records			
city, town			state	

7. Description

Survey No. F-1-178

Prepare both a summary paragraph and a general description of the resource and its various elements as it exists today.

CONTRIBUTING RESOURCE COUNT: 10

The Samuel Dutrow Farmstead is an agricultural complex centered on a circa 1872 frame dwelling and its associated outbuildings which include a two-story frame wash house or summer kitchen, a chicken house, an ice house, and a garage in a group of three adjoining frame structures, two other chicken houses, a frame blacksmith shop in very deteriorated condition, a frame wagon shed/corn crib, a frame and stone bank barn, and a concrete block dairy barn with a milk house an concrete silo. The outbuildings range in date from about 1872 to the early 1940's. The farmstead is located on the east side of Buckeystown Pike (Md. 85) about two miles south of Buckeystown and 1-1/2 miles north of Tuscarora, Frederick County, Maryland. The principal elevation of the house faces west and is on axis with a short driveway from the main road. The house is currently unoccupied. A modern non-contributing dwelling is located just northeast of the house and is currently the home of the owners. Most of the contributing buildings in the farmstead are in fair condition, while the blacksmith shop is partially collapsed. Dates for the buildings are based on architectural evidence, historical maps, and land records.

The main dwelling is a five-bay structure with a two-story rear wing extending from the northeast corner. The exterior is covered in german siding with weathering The roof is standing seam metal and interior end chimneys are located white paint. on the north and south gable ends. The west elevation has a central cross gabl with a round-arched window and a scroll-sawn finial at the peak. A one-story porch covers the center three bays of the facade. The porch has square posts with simple ogee brackets and is ornamented with several bands of scroll-sawn molding trim. The windows are 2/2 with louvred shutters. The center entrance has a two-light rectangular transom and a four-panel door with arched molding trim. The south elevation has only two attic windows with 2/2 sash. The north elevation has a single bay toward the rear of the main section with 2/2 windows. The north elevation gable is covered with three patterns of wood shingles. On the north side of the rear wing is a one-story porch with an enclosed section at its east end which contains a storage room. The south elevation of the wing has a two-story integral open porch with enclosures of different widths on both the levels. The supporting posts of the porch are deteriorated and only a small section of scroll-sawn balustrade remains in place on the second story. A one-story porch extension is located on the east end of the wing; it is enclosed with wire screens.

The interior plan of the house has two rooms flanking a central stair hall in the main section, with a dining room and kitchen in the rear wing. The archway between the hall and the north parlor is wider than is usually seen in houses of the same period in Frederick County, although this feature became common nationally in the last quarter of the 19th century, with the openings often draped with portieres. In both the north and south parlors and the dining room are molded wood mantelpieces featuring raised panels and center bull's eyes. The walls of the first story are plaster with mid-20th century wallpaper. The dining room has a molded chair rail and baseboard. The door and window surrounds are also molded and have bull's-eye corner blocks. The interior doors have four panels. The kitchen has

Period prehis 1400 1500 1600 1700 X 1800 X 1900-	-1499 archeology-historic -1599 agriculture -1699 architecture -1799 art -1899 commerce		landscape architecture law literature military music t philosophy politics/government	religion cup religion cup science cup sculpture cup social/ humanitarian cup theater cup transportation cup other (specify
Specific	dates C. 1872 - C. 1940	Builder/Architect		
	Applicable Criteria: XA and/or Applicable Exception: A Level of Significance:	ABCD		
				· · · · · · · · · · · · · · · · · · ·

Survey No.

F-1-178

8. Significance

Prepare both a summary paragraph of significance and a general statement of history and support.

The Samuel Dutrow Farmstead is moderately significant for the architecture of the main dwelling and the number and variety of remaining outbuildings. The house, built about 1872 after Samuel Dutrow purchased the property as an investment, has the typical form of vernacular rural houses with the added interest of scroll-sawn trim and shingles on the porches and gables. In the last quarter of the 19th century, this type of elaboration on the basic farmhouse became common and the vicinity of Buckeystown has several examples of fine wood trim, reflecting the quality of work by Buckeystown builders, principally Newton R. Schaeffer, who built many of the fine houses in Buckeystown's National Register Historic District It is not known whether Schaeffer was the builder of the Samuel Dutrow Samuel Dutrow was himself the owner of several farms in the Adamstown Region and was well able to afford the work of the most able craftsmen of the day. In 1874, the farm was called "The Manor Farm" in a deed to Henry Culler. This name was applied to many properties on the original Carrollton Manor tract. Samuel Dutrow's heirs sold the farm to George S. Allnutt in 1915, in whose family it remained until purchased by Mr. Arthur E. Shook, one of the current owners. Most additions and alterations to the house and the outbuilding groups were therefore made by the Dutrows' tenant farmers and the Allnutts. The variety of uses apparent in the outbuildings exemplifies the progress in agriculture in Frederick County from mostly grain-producing farms to dairying and from self-sufficiency to trade and commerce with towns and other enterprises.

9. Major Bibliographical References

Survey No. F-1-178

Land Records of Frederick County Titus, C.O. Atlas of Frederick County, 1873

10. Ge	ographical Dat	:a	
	nated property 20 acres e Buckeystown, Md. do NOT complete UTM re	eferences	Quadrangle scale 1:24000
AZone Easting		B	Easting Northing
C		D	
	ry description and justificati y 20 acres centered on		dwelling on Tax Map 103,
List all states state	and counties for properties code	county	code
state	code	county	code
11. For	m Prepared B	У	
name/title	Janet L. Davis, Histor	ic Sites Surveyor	
organization	Frederick County Plann	ing & Zoning Dept da	ate May 1993
street & number	12 E. Church Street	te	lephone 696-2958
city or town	Frederick	st	ate MD. 21701

The Maryland Historic Sites Inventory was officially created by an Act of the Maryland Legislature to be found in the Annotated Code of Maryland, Article 41, Section 181 KA, 1974 supplement.

The survey and inventory are being prepared for information and record purposes only and do not constitute any infringement of individual property rights.

return to:

Maryland Historical Trust

Shaw House

21 State Circle

Annapolis, Maryland 21401

(301) 269-2438

MARK TO SERVICE TO COMMUNITY PLACE
CROWNSVILLE, MD 21032-2003

7.1 Description (Continued)

tongue-and-groove wainscot and appears to have been remodeled in the mid-20th century. An enclosed rear staircase is located in the southwest corner of the room.

Domestic outbuildings:

Group of three outbuildings: Located northeast of the house is a group of three adjoining frame outbuildings which had various domestic uses over time. At the west end of the group is a one-story section which had an ice house under the floor, according to Mr. Arthur Shook, one of the current owners. The above-ground shed may have been a meathouse, its interior showing open rafters with nails and a shelf around the interior walls. The exterior of the building is covered with vertical boards on the south elevation and asbestos shingle on the north side. An integral roof overhang on the south shelters the only door, a vertical tongue-and-groove off-center opening. The edge of the roof has a serpentine bargeboard, which is repeated on all three sections of the group and on some of the other outbuildings. The center section of the group is slightly taller than the flanking sections and has a projecting south elevation with two arched louvred vents. The siding is board and batten with traces of whitewash. Below the vents is a plywood covered opening which suggests a possible use as a chicken house. It is now a garage and storage building with swing doors on the north elevation in an enlarged opening. The easternmost part of the group is also covered with board and batten siding and is currently used as a garage. The interior shows that the board and batten of the chicken house is still in place, indicating that this part may have been a later addition to the group. The group may have been started as the meathouse and chicken house possibly in the early 1870's, with the garage added as a carriage house later, and the bargeboard trim used to unify the appearance of the group of three structures.

Wash house: The building described by Mr. Shook as a wash house is a two-story frame building with a basically square plan, german siding and four panel doors in the west and south elevations. A third opening on the north side has been closed off. The only windows are on the second story in the west side and two windows on the east elevation on each story. The sash is 2/2 with one 2/3 on the east side. The chimney is interior, and the roof is corrugated metal.

Chicken houses: The two frame chicken houses are located east of the rest of the domestic group. One faces east and has a composition roof and tongue-and-groove siding. The windows in the east side are 3/3. The second building faces south and has a standing seam metal roof with tongue-and-groove siding. The windows facing south are covered with chicken wire. These chicken houses may have been built in the first quarter of the 20th century.


Blacksmith shop: The partially collapsed blacksmith shop is in very deteriorated condition and little of its original aspect can be determined. It had vertical board siding and a standing seam metal roof. It was identified by Mr. Shook as the original shop on the farmstead and it is oriented toward the bank barn, as are existing blacksmith shops in other late 19th century farms. It was probably built about the same time as the house and the barn, in the early 1870's.

7.2 Description (Continued)

Bank barn: The frame bank barn, built about 1872, has a stone foundation and the ramp to the barn floor is on the north elevation. The exterior is covered with tongue-and-groove siding and the roof is standing seam metal. Circular saw marks are visible on the interior framing members, which are joined by mortise and tenon. The south elevation stall level is enclosed with horizontal boards and tongue-and-groove siding.

Wagon shed/corn crib: The wagon shed/corn crib is located near the bank barn's southwest corner and at an angle to the barn. It has extended sheds on each side of the original central pass-through and flanking corn cribs. The exterior is covered with vertical board siding and the roof is corrugated metal. The wagon shed was probably built later than the barn, about 1880-1890.

Dairy barn, milk house, and silo: The concrete block dairy barn was originally built about 1930-1940 and consisted of the southern 9 bays of the current structure, the northern four bays being added about 1950, according to Mr. Shook. The original north facade of the earlier structure was relocated to the north end of the new part. The barn has a standing seam gambrel roof and the windows are 6/6 wood sash. The gables are faced with german siding. The milk house is located on the east side of the barn and is a one-story building of plain concrete block with a standing seam metal roof. The poured concrete silo was probably added about 1950 and is non-contributing.

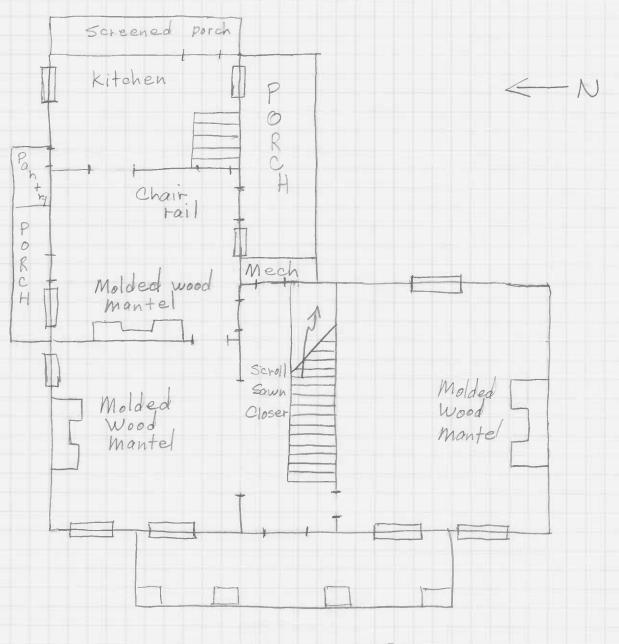

F-1-178
Samuel Dutrow Farmstead
Frederick County


Janet Davis April 15, 1993


Not to Scale

1919 * Buskeystown Pike

~	Lot Size, Description, Other Information, Original Tracts	Cost	Miscellaneous	
mas ien ion, eps.op	"The Manor Jaim" Resitoh "Cairoll Manoy" Residuely on For Ha estate of Helen E. Shook	el "	187 Q, ±	
næra. Ollu	llmitt utt			
en				
rustee		\$ 3000	Q1 2. 0 1.1 1 1 2 1 1 1 6	,
	Janual Dutrow, dec.	3. Cennico	1880 I alluit	il.
		#14,154.3	7	
t. Du	trow of LUAT of Samuel Dution	\$ 14, 154.37		

Liber/Folio	Grantee	Grantor	Original Tracts	Cost	Miscellaneous
1639/369 18apr 90	Steven Orthur Shook & Arthur Showas Shooks	1 (0000000)	"The Manor Jaim" Factor "Carroll Manor" Freudieg on Jos Ha estate of Helen E. Shook	el"	187Q. ±
477/460 8 Mar 49	arthur E. 7 Helen Shomas Shook	mm Thomas a 4 Helen R. allu	Elmitt		
41 8/285 10 Jul 39	Mm. Thos. allnutt et	Parsons			
418/283 7£16-39	Parsons	John S. Meuma + Edward z. Smith, trustee		\$3000 S. allnutt	let al us. Diances C.
HWB 312/256	g	Dullow etax	Samuel Dutrow, de.		1880 I allwith
TG 1/263 10 Mar 1874	SI SI	Henry Culler	"The Manor Farm"	#14,154.3	7
TG 1/262 10 Mar 1874	Henry aller	Richard P.T. Du and Samuel Dution, execs o	trow of LU+T of Samuel Dutro	#14,154.37 ev	
CM 8/599 1 Jul 1872		Henry Baker, t in Equity 3522 Equity Record	LCM 3/1	#17,456.0	6 & Dee Plat in Exhibit B. D." , Lot No. 3 in Equity 3046
Equily Regard					
Control and the control and th					
J					

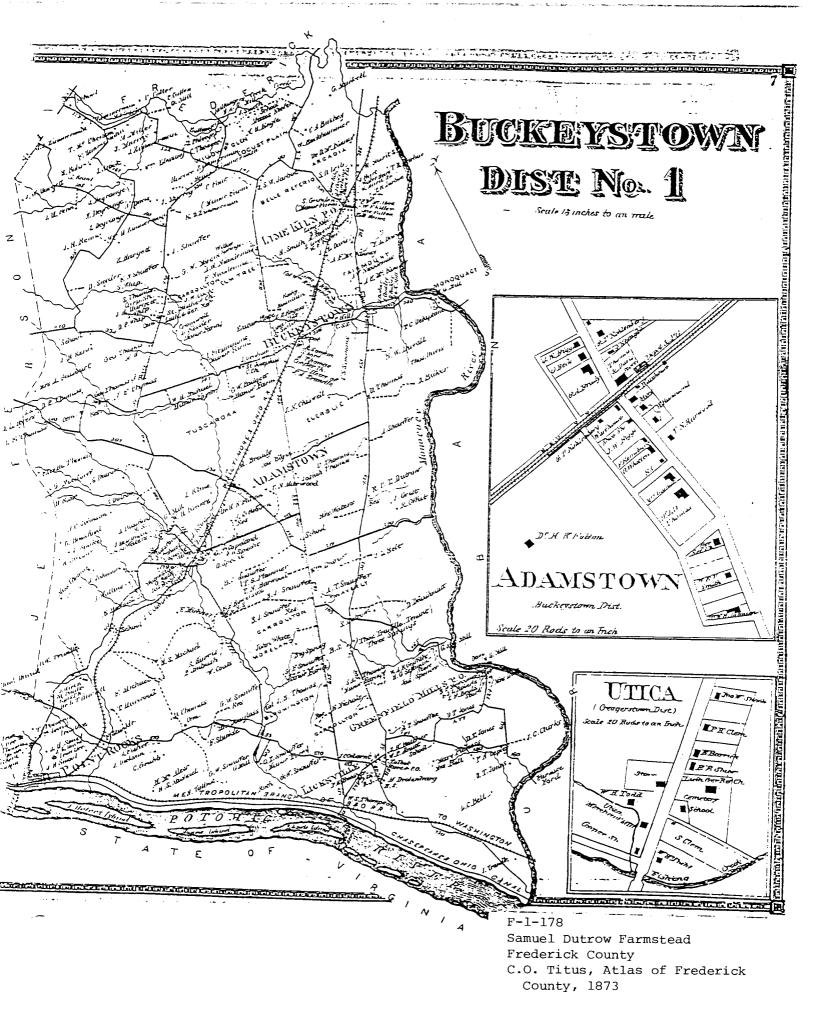

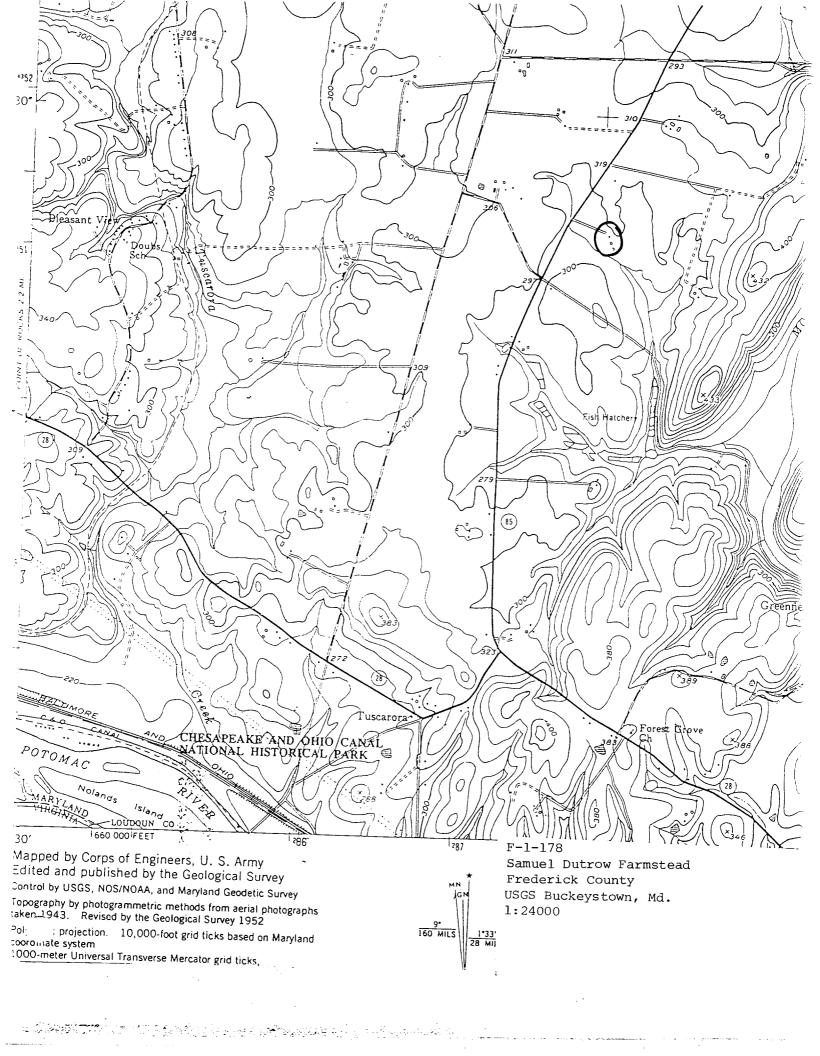



Somuel Cutrow form tead Frederick County Photo: Jonet Davis Actil 1093 Nea. loc. 1 Md. SHPU, Crownsulle, Md Northwest Corner Wew



F-1-178 Samuel Dutrow Farmstood Frederick County Photo : Jaket Dours Nea- loc. i Md. SHPO Crownsville Ad Forch trundetail



F=1-178 Somuel Dutrow Formstead Frederick County Photo: Janet Dovis April 1993 Nea loc. : Md. SHPO, Crownsville, Md. South elevation 3/8



F-1-178 Samuel Dutrow Formstead Frederick County Photo: Janet Davis April 1993 Neg. loc.: Md. SHPO Cicunsville Md Typical montelpiece



F-1-178 Somuel Dutrow Formstood Flederick County Photo: Tonet Down Foril 1993 Neo. loc.: Md. SHPO. Crownsville Md. Domestis outboldings: ice house chicken house, garage, South elevation 5/8



Samuel Dutrow Farmstead Frederick County Photo: Tomet Davis Neg. loc.: Md SUPO, Crownsville Mrd. Wash rouse southwest corner were 6/8

F_1-178



F= 1= 17x Somuel Duren Formstood Frederick County Arn 1993 Near loc : Md. SHPO, Crowneurle Mid Bank both, north elevation 7/8



Sminuel Eulious Formatourd Frederick County Nea. loc.: Md. SHOO. Crownsville. Md. Doing born -10 and wasen shed view from northwest